Select the Measuring Unit
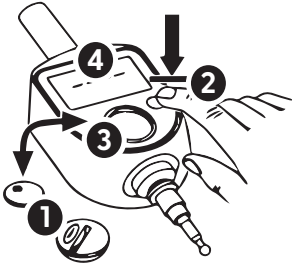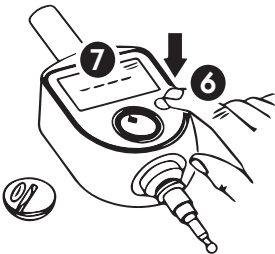# (3D Probe Digigraph)

❶ Remove battery cover and battery

❷ Press and hold the ON/OFF button

❸ Insert battery

❹ The display 3 shows: „----"
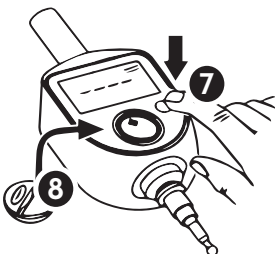

❺ Release the ON/OFF button

❻ Press the ON/OFF button for < 1 sec.

❼ Display shows „inch"

To change the measuring unit to „mm" press the ON/OFF button for < 1 sec

Note: „mm" does not appear on the display.

❼ Press the ON/OFF button for < 1 sec. to store the required measuring unit.

Note: The selected measuring unit remains stored even when the battery is removed.

❽ Reinsert the battery cover